



# 通用汽车记分卡截屏图像

## 背景

对于所有 IATF 16949 审核，根据“获得及保持 IATF 认证的规则第五版本”，有三个关键步骤可确保制定稳健的考虑了绩效的审核计划：

规则 5.7.1 c) “自上次审核以来的顾客和内部绩效数据；”

规则 5.7.2 审核计划“认证机构应对必需信息（见第 5.7.1 条）进行分析”

规则 5.7.2 a) “每项审核计划应确定至少有一小时在现场……用于数据验证……”

本记分卡 IATF 16949 快速参考指南明确了上述各项规则所述步骤相关的记分卡、信息和要求。

本文件提供了相关的参考记分卡和其他绩效指标的截屏图像，目视化展示了通用汽车记分卡 IATF 16949 快速参考指南中确定的客户绩效评估指标。

通用汽车记分卡 IATF 16949 快速参考指南可访问 [IATF\\_globaloversight](http://IATF_globaloversight) 网页获取。

## 目录表，显示所提供的 GM Supply Power 截屏图像示例


<u>屏幕图像/表格名称</u>	<u>页码</u>
SCMS 供应商记录界面	2
详细影响报告	3
CS 2 通知函示例	4
载明 BIQS 等级的可采购性报告	5
详细影响报告	5
载明整车/动力系统发运暂停详细影响报告	6
载明市场措施的详细影响报告	6
如何查阅可采购性报告和详细影响报告	7
详细影响报告结构	7
NBH 和市场措施详情	7
如何查阅 SPPS 记录信息	8
SPPS 详细报告示例	10



# 通用汽车记分卡截屏图像

SCMS 供应商记录界面显示有客户名称、制造邓白氏编码、城市和州，箭头标记如下。  
对邓白氏（DUNS）编号的说明如下：

- Cottage DUN（前 3 位是零“000”）通常为支持场所或二级签约的分供方场所
- Ultimate DUNS 编号表示该公司的母公司或集团公司，不是制造场所
- Shipping DUNS，签约的物流仓库，从该仓库发运成品给 GM，不是制造场所
- Header DUNS，通常为用于投标和合约签署的销售办公室，不是制造场所
- 制造 DUNS 编号是产品制造现场的编号，对零件质量/物流负责
- 本示例为通用汽车的一个现场的例子

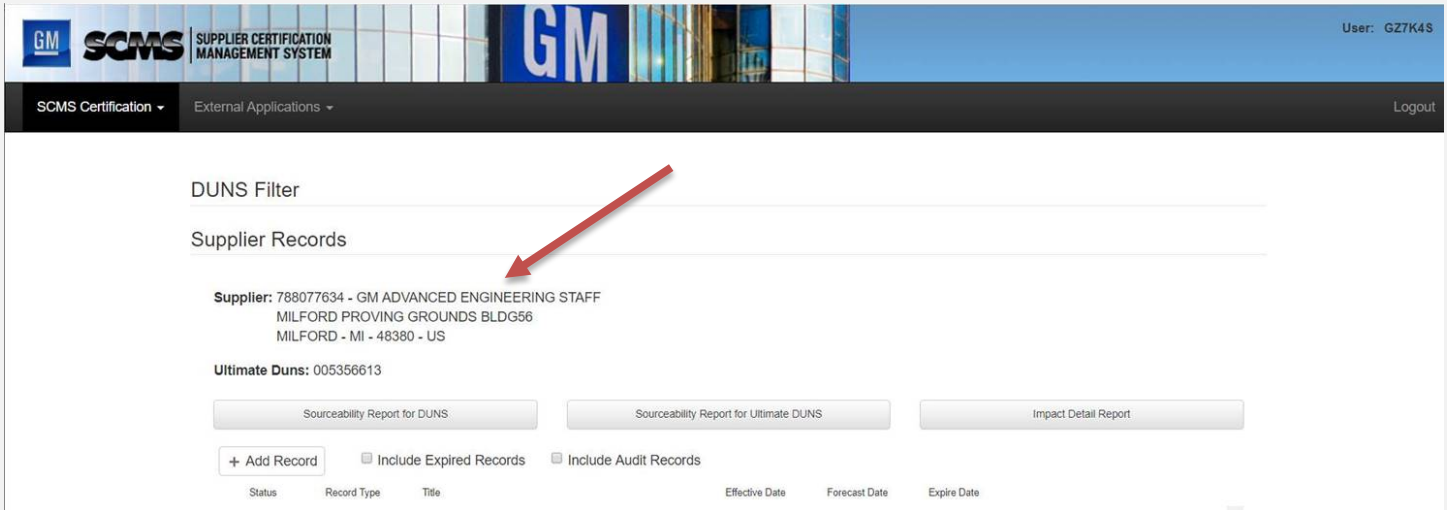

通用汽车当前质量要求的详细信息，可在 [GM SupplyPower 下的 Document Library](#) 中查阅，包括：GM 1927 17、BIQS 要求、质量 SOR（要求声明）等。更改内容见 [SupplyPower](#)。



# 通用汽车记分卡截屏图像

详细影响报告，载明了严重度、生产中断和 SPPS 描述。同时报告中也载明了其他详细信息。

GM		Impact Detail Report						
Mfg DUNS Location: 123456789 - TESTING - SAO PAULO , SP - BR - GMSA								
**BIQS Survey Score does not impact Sourceability**		Effective Date	Expiration Date					
<del>BIQS Survey Score: 0.5 - Level 1</del>		<del>07/06/2018</del>	<del>07/06/2019</del>	BIQS survey score is not used for BIQS Level, see yellow note				
IATF 16949: CERT		06/07/2018	06/06/2021					
Run at Rate Fail-High Risk:								
PSA:								
SQA:								
NBH: N/A								
Issue Date	PRR/SPPS/SCMS#	Status	Direct Impact	Severity Score/Impact	Type	Primary N/C	Secondary N/C	
10/01/2019	22307	Analyzing	Quality - CCA	5	CCA - Shipment Quality	Packaging	Parts not packaged to specification for service	
08/09/2019	17155	Closed	GSC Rating - CCA	2	CCA - Supply Chain	Shipping	Electronic Communication Discrepancies	
03/14/2019	668	Closed	BIQS	0.5	Quality			
04/10/2019	3793	Closed	BIQS	0.5	Quality			
04/24/2019	5750	Closed	BIQS	2	Quality			
06/01/2019	10108	Closed	BIQS	0.5	Quality			
06/17/2019	11875	Approving	BIQS	0.5	Quality			
06/18/2019	11942	Closed	BIQS	2	Quality			
08/30/2019	19526	Verifying	BIQS	0.25	Quality			
05/31/2019	6667	Annonmin	GSC Rating - Production	0.5	Supply Chain	Communication (Customer Satisfaction)		

注：

详细影响报告中“直接影响”项下列出的全部问题，不论其类型（BIQS、CCA、GSC-物流等），都需要制定纠正措施计划，并影响客户评级。

忽略详细影响报告或任何其他记分卡、商业绩效报告、6 panel 等的 BIQS 调查得分和级别，而仅使用可采购性报告上所示的 BIQS 级别。

SPPS/SCMS 一列含 SPPS 记录编号。所有新发生的问题都有 SPPS 记录。请注意，SCMS 供应商记录（而非 SPPS 记录）中提供了 NBH/服务中断/市场措施的详细信息。

状态栏明确了 SPPS 问题的状态，各状态的定义参见 GM 1927-17。

GM 1927-17 中以矩阵形式对严重度打分作了说明，BIQS 评级参考的是过去 6 个月内所有问题的严重度评分的总和。在客户 BIQS 等级是 5 级时，要参考过去 12 个月的质量历史数据。此外，认证机构审核员应采用严重度评分确定待评审的问题的优先级。



# 通用汽车记分卡截屏图像

## CS 2 通知函示例

Subject: General Motors SPPS 000 – Entry into Controlled Shipping Level 2

TO LIST: [test@test.com](mailto:test@test.com); [test@gm.com](mailto:test@gm.com)

CC LIST: [test2@gm.com](mailto:test2@gm.com)

Date: 31-May-2019 3:28 PM ET

Supplier Name  
Title  
000000000 – Supplier Name  
Street Address  
City, State, Country Zip code

Controlled Shipping is part of General Motors Supplier Quality Processes and Measurements Procedure and is part of the Supplier Quality Improvement Process. General Motors has determined that current controls by your organization are not sufficient to insulate GMPT-WARREN TRANSMISSION from the receipt of nonconforming parts/material produced by your facility. This letter is formal notification and confirms discussions held with Supplier Name that your facility has been placed in Controlled Shipping Level 2 for the following nonconformances:

Part Number	Part Name	SPPS #	Nonconformance
00000000	Part Name	000	Nonconformance description

### Links to SPPS Application:

- [GM/JV Users click here](#)
- [Supplier Users click here](#)

The procedures you have enacted to date have been insufficient in stopping the flow of nonconforming material to our plants. Therefore, **you must immediately:**

- Implement and pay the costs of a GM-defined containment activity over and above your current process controls and containment activity.** The GM-defined containment activity is in addition to the current controls and containment activity.
- Clearly identify the qualified shipments. Clearly document and communicate post Corrective Action Break-Points to the Controlled Shipping Provider.**
- Identify the root cause of the nonconformance(s).**
- Define and implement irreversible corrective action for the root cause(s) of the problem(s).** This will normally include revised FMEAs, process flow diagrams, and process control plans.
- Validate effectiveness of the corrective action.** Outline your plan for reviewing your controlled shipping data.
- Track and report your progress by using a GM-approved report format. You must submit regular reports as specified by the GM representative monitoring this activity.**
- Meet the defined exit criteria.** The parts will remain in controlled shipping until irreversible corrective actions are implemented and confirmed. Exit criteria will be established that verify the identification of the true root cause, and verify that appropriate corrective action is implemented, properly documented, and effective.
- Notify your IATF 16949 registrar of the CS2 status.** You are to notify your certification registrar, in writing, within five (5) working days when a customer places you in Controlled Shipping Level 2.

*Note: Failure to comply with this process, or the inability to implement a successful action plan or containment activity, will result in the implementation of new business hold. Reference the GM Supplier Quality Processes and Measurements Procedure at GM SupplyPower for additional details concerning Controlled Shipping.*

If you have any questions, contact GM Person Name, Title phone, [email](#), who will be monitoring and defining your controlled shipping activities.

Sincerely,  
GM Person Name  
Title  
Department



# 通用汽车记分卡截图图像

## 载明 BIQS 等级的可采购性报告

制造 DUNS 编码	供应商名字	BIQS 级别	交付评级--生产	服务件质量	IATF 认证状态
11111111	GM SUPPLIER LLC	1	100	100	Approved

Manufacturer DUNS	Supplier DUNS	Supplier Name	Location	Country Code	Region	BIQS Level	IATF Certification Status	Launch Performance	NBH	GSC Rating - Production	Quality - CCA	GSC Rating - CCA	Location Risk Rating	Financial Risk Rating	Conflict Minerals	Diversity
11111111	222222	GM SUPPLIER LLC	ROCHESTER HILLS, MI	US	GMNA	1	Approved	100	N/A	100	100	100	1	1	NA	N

Action Required	
BIQS Level	If BIQS is Blank, 0 or RED, Sourcing requires Quad Report and SQ Leadership Approval (Mfg Duns)
IATF Certification Status	If IATF Certification is NCR, N/A, 0/PP or N/A, Sourcing requires Quad Report and SQ Leadership Approval (Mfg Duns)
Launch Performance	If Launch Performance is RED, Sourcing requires Quad Report and SQ Leadership Approval (Mfg Duns)
NBH	If NBH is RED you are on New Business Hold
GSC Rating - Production	If GSC Rating - Production is Red, sourcing prohibited unless waiver approval by GSC and or GM Alternates (Ship from Duns). If GSC Rating - Production is Yellow, still considered sourceable, buyers please proceed with caution.
GSC Rating - CCA & Quality - CCA	If GSC Rating - CCA or Quality - CCA Score is Red, sourcing approval is required from CCA Global Supply Chain or Quality and SQ using CCA Deviation Waiver form.
Location Risk Rating	If Location Risk Rating (LRR) is RED or NR, supplier is still sourceable. Suppliers and Buyers should contact the GSC Risk Management Team for additional risk information (risk.management@gm.com). LRR is updated quarterly.
Financial Risk Rating	If Financial Risk Rating is RED you must have PUR-01-F1-01 Sourcing Decision approval. If the FRR is blank you must request an FRR rating from Supply Risk Management. Suppliers with FRR Yellow may be awarded business with caution.
Conflict Minerals	If Conflict Minerals Metric is RED, then sourcing decision requires GPSC Leadership approval, conflictminerals@gm.com for next steps. If Conflict Minerals Metric is YELLOW, then supplier should reference the concerns sent via email for next steps.
Diversity	Diversity is reference only.

注:

图例上显示了每个指标的可能评级和颜色

项目启动绩效是对 APQP 合规性的评级

NBH=新业务暂停 (此处 N/A 表示客户未处于 NBH 状态)

通用汽车的 IATF 认证状态等级包括已认证、豁免、暂停以及因各种原因而未认证

GSC 表示交付绩效 (售后服务件和正常生产件, 两个进行单独评级)

CCA (客户服务和售后服务) 表示服务情况 - 显示质量和交付评级

可采购性报告中的任何红色评级, 请转到详细影响报告, 确定相关问题

可采购性报告中的其他评级未用于审核 (场所和财务风险、冲突材料、多样性)

通用汽车的新供应商有一份可采购性报告, 但相应的评级 (BIQS 级别可能为 1 级或 0 级) 可能不适用

单击可采购性报告中的制造商 DUNS 编号, 转至详细影响报告。

## 载明严重度评分和问题类型的详细影响报告

Impact Detail Report						
Mfg DUNS Location: 123456789 - TESTING - CITY, STATE, REGION						
Severity Score/Impact	Type	Primary N/C	Secondary N/C	Major Disruption	Customer Impact	
5	CCA - Shipment Quality	Packaging	Parts not packaged to specification for service			
2	CCA - Supply Chain	Shipping	Electronic Communication Discrepancies			
0.5	Quality				Single Occurrence	Part installed in Vehicle/Eng or Tra
0.5	Quality				Single Occurrence	Part installed in Vehicle/Eng or Tra
2	Quality				Repeat Occurrence	Part installed in Vehicle/Eng or Tra
0.5	Quality				Single Occurrence	Part installed in Vehicle/Eng or Tra
0.5	Quality				Repeat Occurrence	Incoming part. Not installed in Sub-
2	Quality				Repeat Occurrence	Part installed in Vehicle/Eng or Tra
0.25	Quality				Single Occurrence	Part installed in Sub-assembly or V

严重度代表问题对通用汽车的影响, 详见 GM 1927-17



# 通用汽车记分卡截屏图像

载明整车/动力系统发运暂停(Yard Hold)的详细影响报告

## Impact Detail Report

Mfg DUNS Location: 123456789 - TESTING - CITY, STATE, REGION

Customer Impact	Value Stream Impact Location
Level G.2: Critical failure	Yard hold
Level F: Repeat of Level B,D or E	Parts sorting / rework (not yet assembled)
Single Occurrence	Part installed in Sub-assembly or Vehicle/Eng or Trans. Sub-assembly or Vehicle/Eng or Trans repaired before
Repeat Occurrence	Part installed in Sub-assembly or Vehicle/Eng or Trans. Sub-assembly or Vehicle/Eng or Trans repaired before
Multiple Occurrence	Part installed in Sub-assembly or Vehicle/Eng or Trans. Sub-assembly or Vehicle/Eng or Trans repaired before

载明市场措施的详细影响报告

## Impact Detail Report


Mfg DUNS Location: 123456789 - TESTING - CITY, STATE, REGION

Issue Date	PRR/SPPS/SCMS#	Status	Direct Impact	Severity Score/Impact	Type	Primary N/C	Secondary N/C	Major Disruption
09/29/2019	22043	Issued	BIQS	0	Quality			
03/09/2019	SCMS	EXPIRED	BIQS	15	Field Action			Field Action
03/09/2019	SCMS	EXPIRED	BIQS	15	Field Action			Field Action
04/01/2019	SCMS	EXPIRED	BIQS	15	Field Action			Field Action
06/19/2019	SCMS	YES	BIQS	15	Field Action			Field Action
10/03/2019	SCMS	ISSUED	Launch Performance	1	DV/PPV - High Risk			




# 通用汽车记分卡截图图像


如何访问可采购性报告和详细影响报告

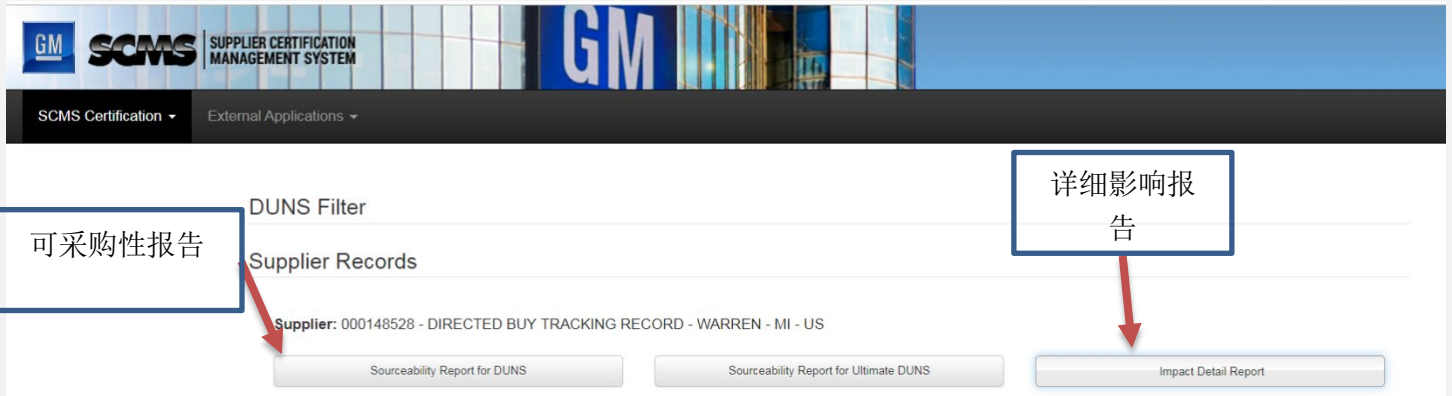

详细影响报告的结构

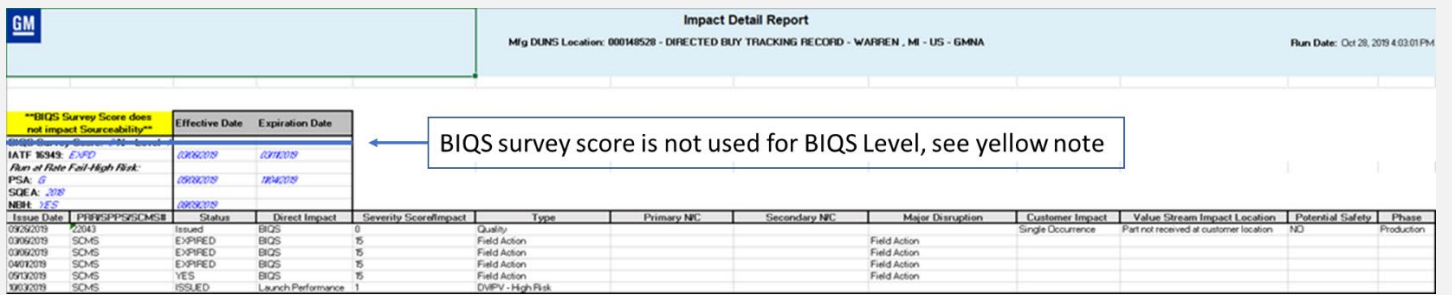

NBH 状态以及市场措施的详情可参见 SCMS 供应商记录界面


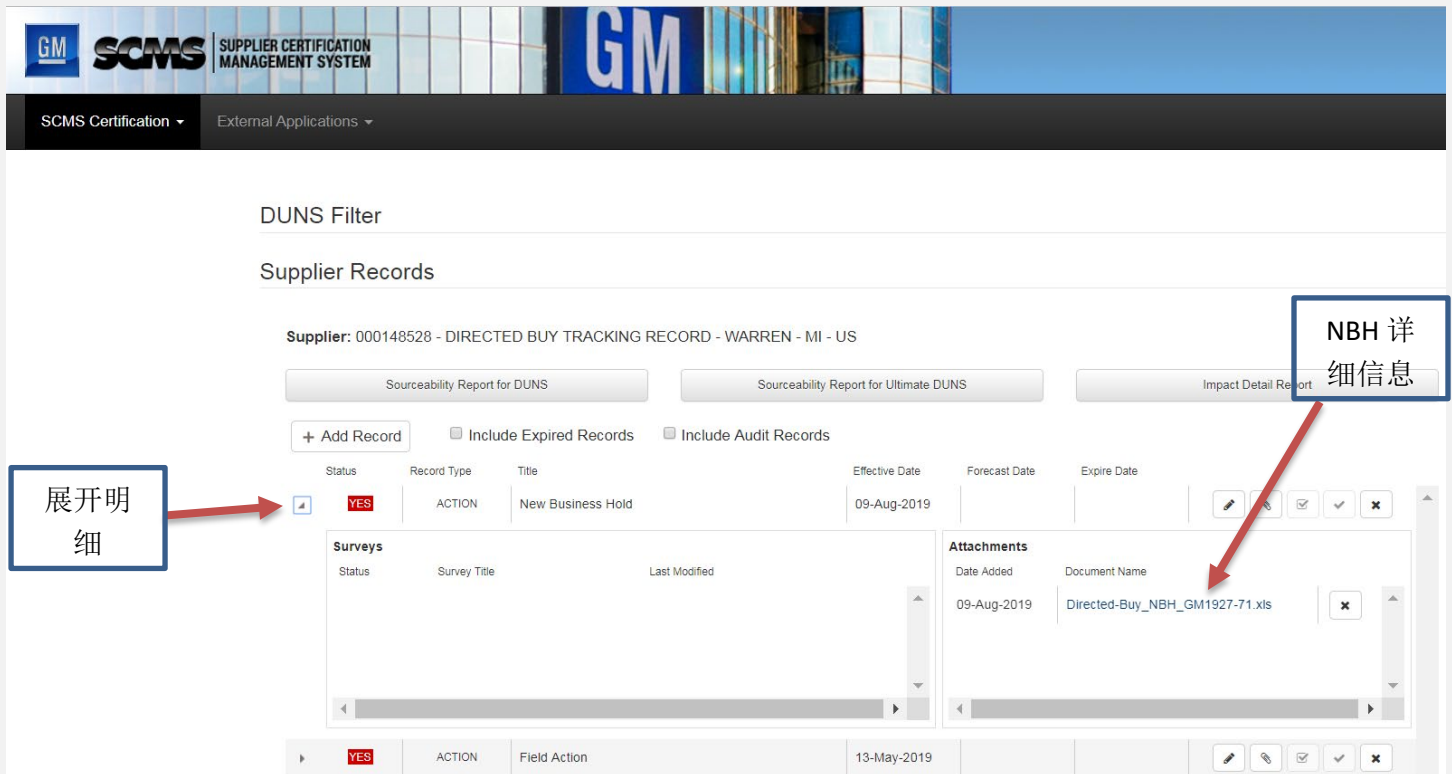





# 通用汽车记分卡截图图像

如何访问 SPPS 记录详细信息

1) 进入 GM SPPS 系统。

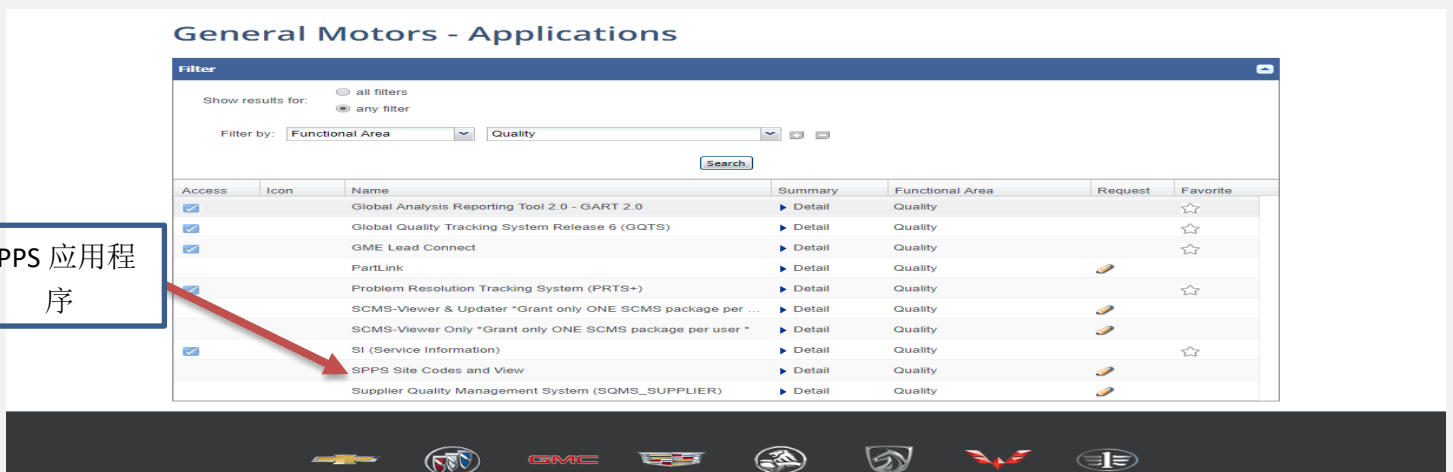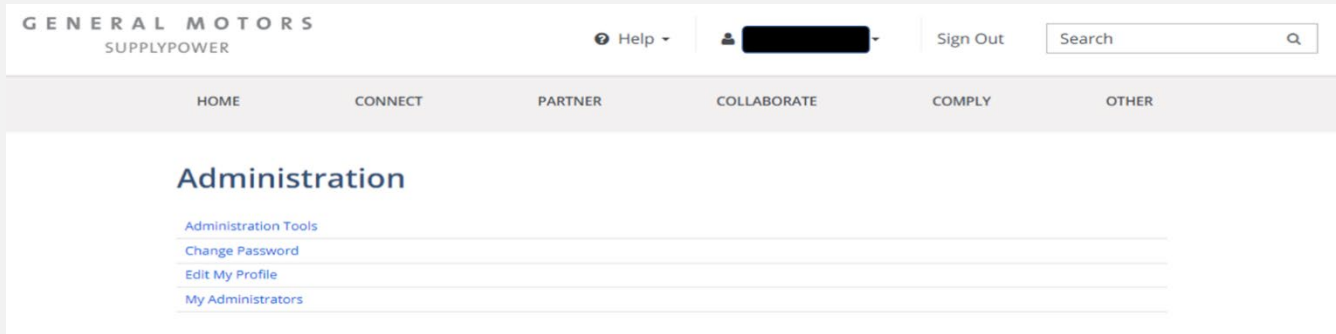


登录后，应显示下图所示界面。

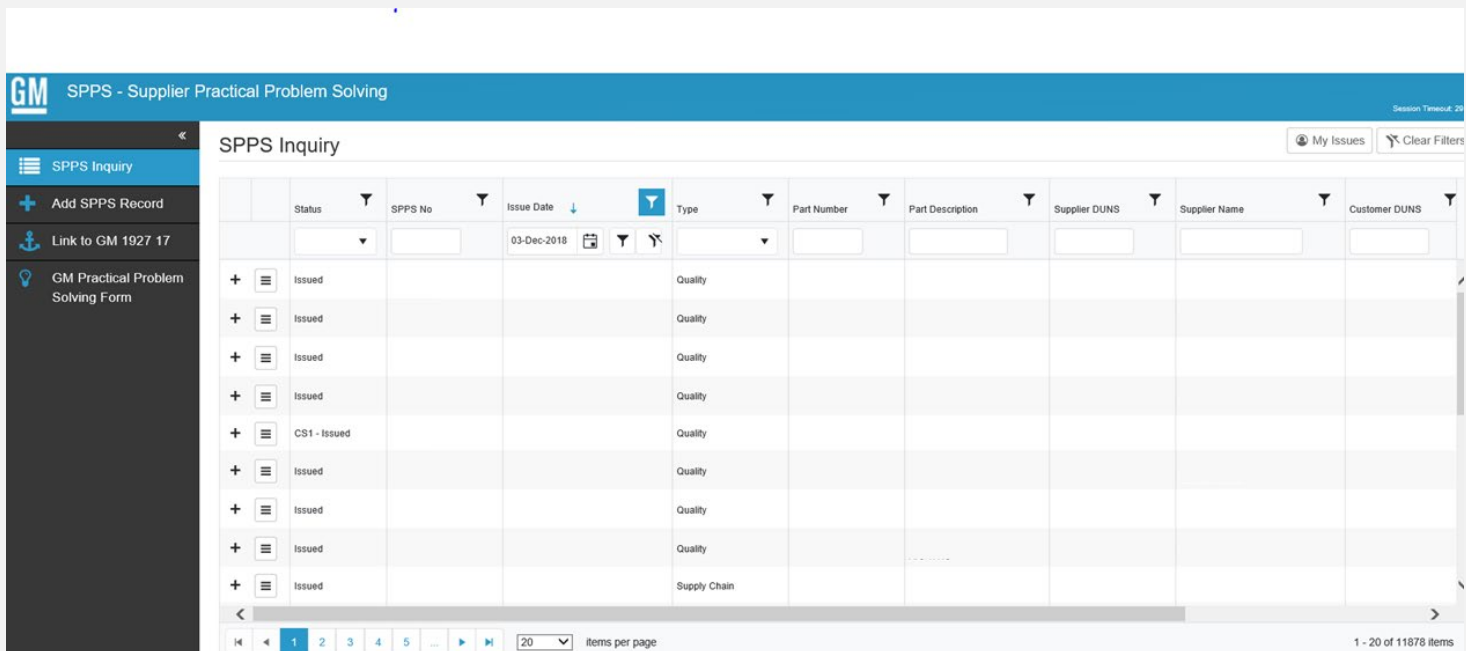




# 通用汽车记分卡截屏图像


2) 在 SPPS No.窗口中输入 SPPS 编号。

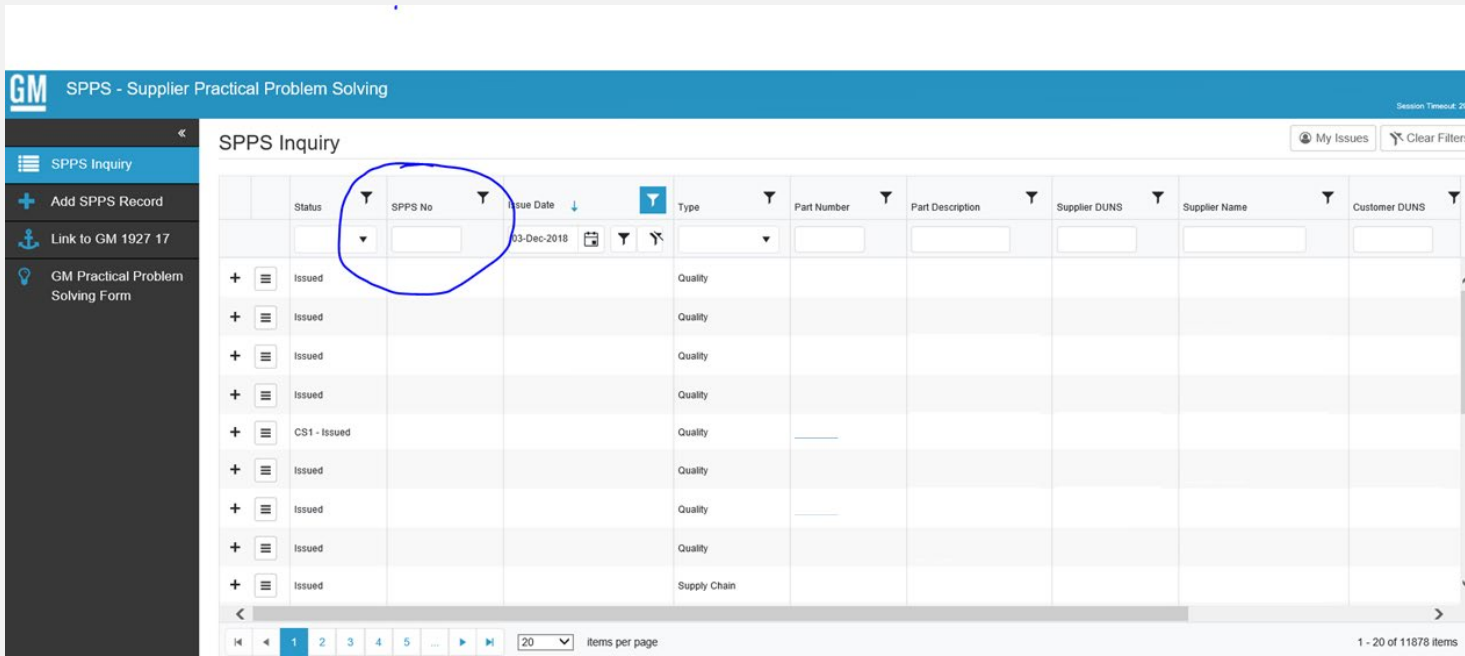

3) SPPS 系统如下图所示。

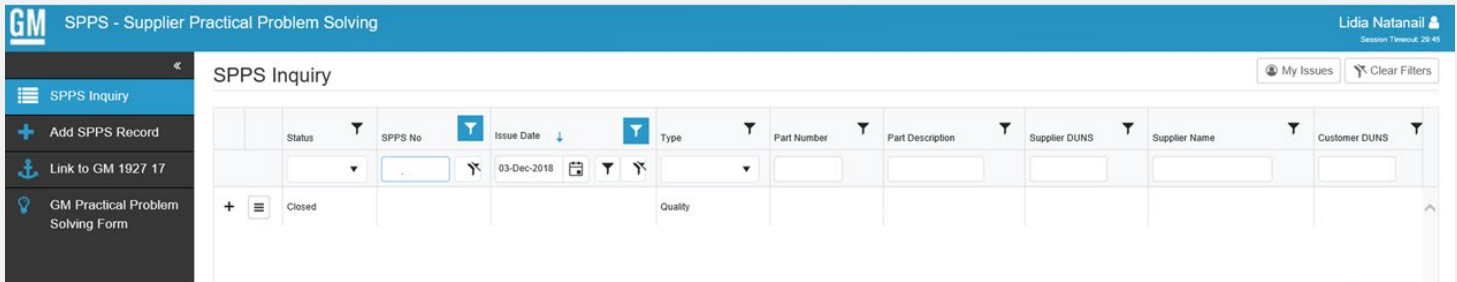


4) 单击“导航”按钮，选择“SPPS 记录详细信息”

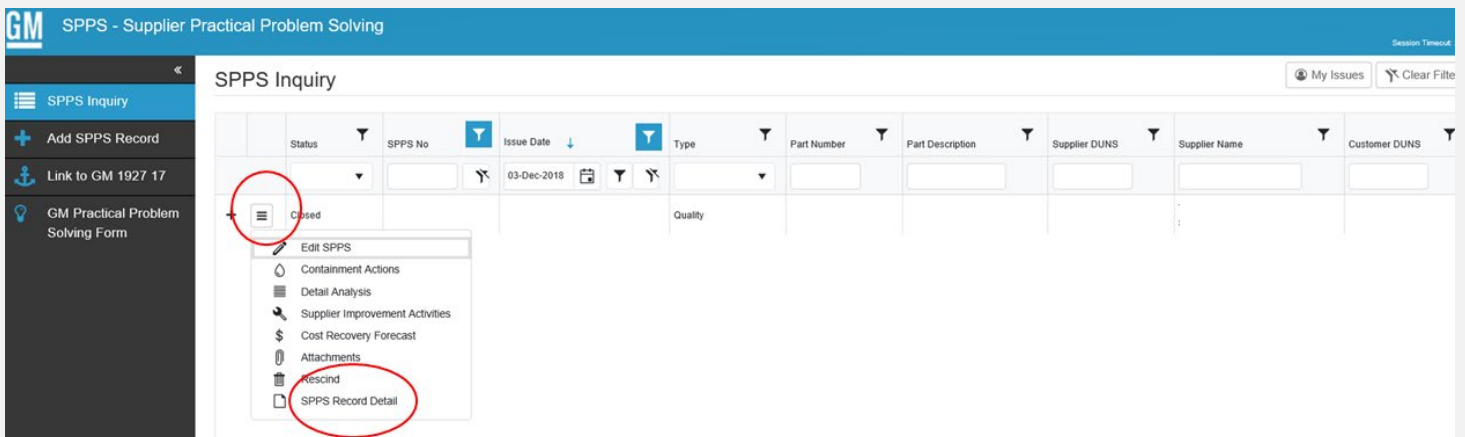

# 通用汽车记分卡截屏图像

5) 跳出 SPPS 记录详细信息。单击右上角的按钮，此信息可以 PDF 格式打印。

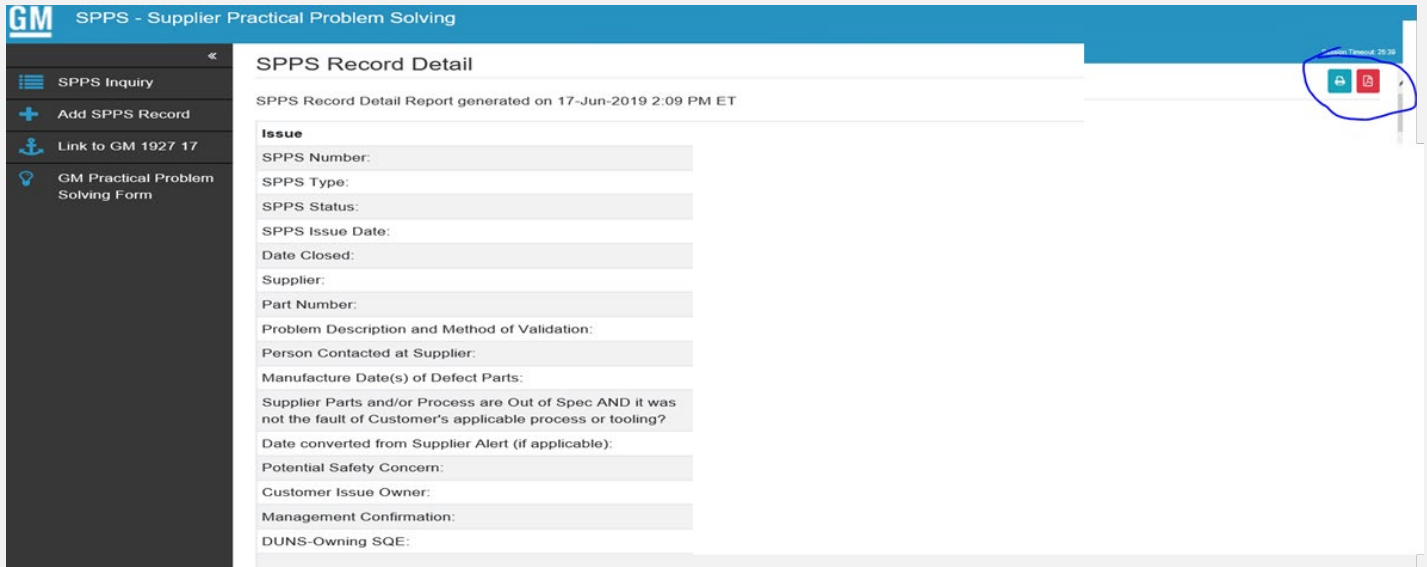

注：即使通用汽车 SQE 已接受客户的纠正措施计划，以将 BIQS 级别提高到 3 级或更高级别，认证机构还需要对纠正措施进行验证，并确认对策是否做横向展开。

## 完整的 SPPS 详细报告示例

下图提供了 SPPS 记录详细信息中的字段和参数的完整列表，并突出显示通用汽车接受的计划。

通用汽车 SQE 的验收以黄色突出显示的字段标识，并标记为“已验证”。

这个实际例子的一些字段已经做了编辑，以删除客户以及涉及的特定产品的信息。



# 通用汽车记分卡截屏图像

SPPS Record Detail Report generated on 12-Aug-2019 9:42 AM ET

## Issue

SPPS Number: 11507  
**SPPS Type:** Quality  
**SPPS Status:** Closed  
 SPPS Issue Date: 13-Jun-2019 10:18 AM ET  
 Date Closed: 25-Jul-2019 11:31 AM ET  
 Supplier: [REDACTED]  
 Part Number: [REDACTED] RADIATOR ASM-ENG COOL FAN MDL  
 Problem Description and Method of Validation: PROGRAM: EZUL

ISSUE DESCRIPTION: External threads on Schrader valve, where high pressure sensor mounts, are stripped and the sensor was not fully installed.

PART DISPOSITION: The supplier has 24hrs to request the return of suspect material for analysis and provide a FedEx shipping account number and shipping directions. After that time suspect material may be scrapped by Fairfax.

CONTAINMENT: Immediate containment is required with applicable breakpoints. Please reply to the Containing section of SPPS as required in GM1927-14.

PART IDENTIFICATION: Identify in SPPS response how individual parts will be marked for certification. Identify all certified containers with a green sticker on the parts label with the initials of the person certifying the material, along with the date it was certified. Do NOT cover up any information on the label. GM Fairfax also requires an 8.5x11 inch paper on 2 sides of the container that says 100% certified for (reason for certification), along with the contact name & phone number. If there is more than 1 certification active, then that 1 page needs to list every issue they are certified for. This labeling must continue for 30 days from the start of certification.

CORRECTIVE ACTION DOCUMENTATION: Complete problem solving documentation, PFMEA, process control plan, and documentation/evidence of controls used to avoid repetition for this issue need to be attached in the SPPS system.

TIMING: Failure to meet the required submission deadline may result in a Customer Satisfaction SPPS. If your analysis requires more than 15 working days, you must request an extension. Extension requests must detail why more than 15 days are required and include an expected completion date. E-mail extension requests to the issuer within 15 working days from the date of issuance and note the extension request in the SPPS Planning section data fields.

Person Contacted at Supplier: Not Listed  
 Manufacture Date(s) of Defect Parts: Unknown  
 Supplier Parts and/or Process are Out of Spec AND it was not the fault of Customer's applicable process or tooling? YES  
 Date converted from Supplier Alert (if applicable):  
 Potential Safety Concern: NO  
 Customer Issue Owner: Glenn D Griffin [REDACTED]  
 Manager Approver for Customer Issue Owner: Santosh Sequeira [REDACTED]  
 Management Confirmation: Santosh C Sequeira [REDACTED] 19-Jul-2019 5:28 PM ET  
**DUNS-Owning SQE:** **ELJ ALBERTO SAUCEDO SANCHEZ** [REDACTED]

## Metrics Data

Phase: Production  
 Customer Quality Impact: Direct Run Rate  
 Customer Impact: Single Occurrence  
 Furthest Location in the Value Stream the Non-Conformance has Reached: Part installed in Vehicle/Eng or Trans. Vehicle/Eng or Trans entered as Direct Run/IPPM. As a result Vehicle/Eng or Trans is/was in float.  
 Last Updated: Glenn D Griffin [REDACTED] 13-Jun-2019 10:18 AM ET

## Containment at Supplier Location

Issue Owner at Supplier Location: Jorge Villanueva, [REDACTED]  
 Is Containment Required at this location? YES  
 Can you meet Daily Requirements? YES  
 Describe Containment Actions Taken or Reason for Non Containment Action: Quality Alert was issued and posted in shop floor. Team was informed about the finding. Sensor correctly installed in valve condition has been audited. Parts has been certified identified with material certification sheet.  
 LE237003 192 = OK, 0= NO OK.  
 LD567003 588 = OK, 0= NO OK.  
 LD567003 390 = OK, 0= NO OK.  
 LE237003 468 = OK, 0= NO OK.  
 MD214002 126 = OK, 0= NO OK

Identification of Certified Material: Sensor correctly installed in valve is marked with blue dot.  
 Last Updated: Jorge Villanueva, [REDACTED] 14-Jun-2019 11:24 AM ET

Assessment Status/Reason:  
 Assessment Details:  
 Supplier Response Details:



# 通用汽车记分卡截图图像

## Containment at Issuing Customer Location

Issuing Customer Location: 007145899 - 18044 - NAO FAIRFAX

Conforming Material Date (from Containment at Supplier Location):

Conforming Material ASN (from Containment at Supplier Location):

Supplier Issue Owner at Customer Location: Jorge Villanueva, [REDACTED]

Is Containment Required at this location? NO

Conforming Material Date (from Containment at Customer Location): 24-Jun-2019

ESEP Provider:

Describe Containment Actions Taken or Reason for No Containment Action: Problem not noticeable until its in production. Condition can not be surely checked without taking the sensor off.

Identification of Certified Material:

Last Updated: Jorge Villanueva, [REDACTED] 14-Jun-2019 11:33 AM ET

Assessment Status/Reason:

Assessment Details:

Supplier Response Details:

Assessment Last Updated:

## Potentially Affected Customer Locations

Customer Location Potentially Affected: [REDACTED]

Conforming Material Date (from Containment at Supplier Location):

Conforming Material ASN (from Containment at Supplier Location):

Supplier Issue Owner at Customer Location:

Is Containment Required at this location?

Conforming Material Date (from Containment at Customer Location):

ESEP Provider:

Describe Containment Actions Taken or Reason for No Containment Action:

Identification of Certified Material:

Last Updated:

Assessment Status/Reason:

Assessment Details:

Supplier Response Details:

Assessment Last Updated:

## Detail Analysis

Root Cause: Sensor was installed incorrectly on condenser valve due to Torque controller was not in fix position (loose condition) and seating fixture did not permit 100% vertical position, providing chances to place sensor in a tilted position.

Last Updated: Jorge Villanueva, [REDACTED] 25-Jun-2019 4:04 PM ET



# 通用汽车记分卡截屏图像

Assessment Status/Reason:	
Assessment Details:	
Supplier Response Details:	
Assessment Last Updated:	
<b>3P Supplier Improvement Activities</b>	
Improvement Activity Type:	Predict
BIQS Elements / MMOG-LE Subchapters:	PFMEA
Target Completion Date:	28-Jun-2019
Expected Conforming Material Date:	12-Jul-2019
Actual Completion Date:	12-Jul-2019

First Conforming Material ASN:			
Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Torque/Angle strategy was included as detection control in PFMEA and CP.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:11 PM ET
	Torque/Angle strategy is being included as detection control in PFMEA and CP.	Jorge Villanueva [REDACTED]	26-Jun-2019 12:45 PM ET
Supplier Verification Steps Taken:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Torque/Angle strategy was included and evidence is included in presentation.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:11 PM ET
Approved:	Glenn D Griffin, [REDACTED] 25-Jul-2019 10:12 AM ET		
<b>Verified:</b>	<b>ELI ALBERTO SAUCEDO SANCHEZ,</b> [REDACTED] 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			
Supplier Response Details:			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] 25-Jul-2019 11:31 AM ET		



# 通用汽车记分卡截屏图像

Improvement Activity Type:	Prevent		
BIQS Elements / MMOG-LE Subchapters:	Process Change Control		
Target Completion Date:	26-Jun-2019		
Expected Conforming Material Date:	26-Jun-2019		
Actual Completion Date:	26-Jun-2019		
First Conforming Material ASN:			
Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Seating fixture was adjust to correct position and allow 100% vertical position, avoiding risk to place sensor in a tilted position. Torque controller arm was installed to fix torque controller device avoiding movement and providing better control for the operator to execute the operation.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:16 PM ET
	Seating fixture was adjust to correct position and allow 100% vertical position, avoiding risk to place sensor in a tilted position. Torque controller arm was installed to fix torque controller device avoiding movement and providing better control for the operator to execute the operation.	Jorge Villanueva [REDACTED]	26-Jun-2019 12:44 PM ET
Supplier Verification Steps Taken:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Fixture was adjusted, before and after pictures are included in report presentation. Arm was also installed, evidence is also provided in report presentation.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:16 PM ET
Approved:	Glenn D Griffin, [REDACTED] 25-Jul-2019 10:12 AM ET		
Verified:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			
Supplier Response Details:			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] 25-Jul-2019 11:31 AM ET		

Improvement Activity Type:	Protect
BIQS Elements / MMOG-LE Subchapters:	Standardized Work
Target Completion Date:	26-Jun-2019
Expected Conforming Material Date:	26-Jun-2019
Actual Completion Date:	26-Jun-2019
First Conforming Material ASN:	



# 通用汽车记分卡截屏图像

Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b> Operator reinforcement was done on Jun 14 , 2019.	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 26-Jun-2019 12:40 PM ET
	Operator reinforcement was done on Jun 14 , 2019.	Jorge Villanueva [REDACTED]	26-Jun-2019 12:38 PM ET
Supplier Verification Steps Taken:	<b>Description</b> Operator reinforcement was verified on June 14, 2019	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 26-Jun-2019 12:40 PM ET
Approved:	Glenn D Griffin, [REDACTED] 25-Jul-2019 10:12 AM ET		
Verified:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			
Supplier Response Details:			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] / 25-Jul-2019 11:31 AM ET		
<b>Site Read Across Improvement Activities</b>			
Improvement Activity Type:	Site Read Across		
BIQS Elements:	PFMEA		
Target Completion Date:	26-Jul-2019		
Actual Completion Date:	12-Jul-2019		
Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b> Torque/Angle strategy detection control in PFMEA and CP.	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 12-Jul-2019 12:20 PM ET
Supplier Verification Steps Taken:	<b>Description</b> Torque/Angle strategy was included as detection control in PFMEA and CP. Evidence is included in report presentation.	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 12-Jul-2019 12:20 PM ET
Verified:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] / 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			



# 通用汽车记分卡截屏图像

<b>Supplier Response Details:</b>			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ [REDACTED] / 25-Jul-2019 11:31 AM ET		
Improvement Activity Type:	Site Read Across		
BIQS Elements:	Process Change Control		
Target Completion Date:	12-Jul-2019		
Actual Completion Date:	12-Jul-2019		
Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Seating fixture was adjusted to correct position and allow 100% vertical position, avoiding risk to place sensor in a tilted position. Torque controller arm was installed to fix torque controller device avoiding movement and providing better control for the operator to execute the operation.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:29 PM ET
Supplier Verification Steps Taken:	<b>Description</b>	<b>Updated By</b>	<b>Date/Time</b>
	Seating fixture was adjusted, before and after evidence was included in report presentation. Torque controller arm also was installed and evidence added to report.	Jorge Villanueva [REDACTED]	12-Jul-2019 12:29 PM ET
<b>Verified:</b>	ELI ALBERTO SAUCEDO SANCHEZ [REDACTED] / 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			
Supplier Response Details:			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ [REDACTED] 25-Jul-2019 11:31 AM ET		





# 通用汽车记分卡截屏图像

Improvement Activity Type:	Site Read Across		
BIQS Elements:	Standardized Work		
Target Completion Date:	14-Jul-2019		
Actual Completion Date:	14-Jun-2019		
Supplier Improvement Activity / Reason for No Supplier Improvement Activity:	<b>Description</b> Operator reinforcement was done on Jun 14 , 2019.	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 12-Jul-2019 12:23 PM ET
Supplier Verification Steps Taken:	<b>Description</b> Operator reinforcement was done on Jun 14 , 2019.	<b>Updated By</b> Jorge Villanueva [REDACTED]	<b>Date/Time</b> 12-Jul-2019 12:23 PM ET
<b>Verified:</b>	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] / 25-Jul-2019 11:31 AM ET		
Assessment Status/Reason:	Verified - Improvement Activity and Verification Steps		
Assessment Details:			
Supplier Response Details:			
Assessment Last Updated:	ELI ALBERTO SAUCEDO SANCHEZ, [REDACTED] / 25-Jul-2019 11:31 AM ET		
<b>Controlled Shipping</b>			
Customer Assessment:			
Created:			
Management Confirmation:			
Assessment Reasoning:			
Exit Criteria:			
Kickoff Meeting Complete Date:			
Date Out:			
Supplier Contact:			
Supplier Owner:			
Controlled Shipping Conforming Material Date:			
Identification of Certified Material at Supplier Location:			
Describe Controlled Shipping Actions Taken:			
Inspection Service Provider:			
<b>Customer Issue Owner Change</b>			
Customer Issue Owner:	Glenn D Griffin, [REDACTED] / 13-Jun-2019 10:18 AM ET		

<b>Change Safety Decision</b>	
Potential Safety Concern:	
Last Updated:	
<b>Issue Rescinded</b>	
Management Confirmation:	
Request to Rescind:	
Reason for Rescinding Issue:	

SPPS Reference Number:	
PRTS Reference Number:	
No Supplier Response:	